


High Speed Fuse Links
Fusibili Extra-Rapidi
Überflinke Sicherungen
Fusibles Ultra-Rapides

INDICATOR FUSE

Table with 9 columns: Bulletin 2807, Type, Vpk V, VRMS V, R Ω, Vmin V, IRMS A, Ifuse A, Outline. It lists specifications for Indicator Fuses with ratings like 700, 1000, 500, 700, 0.3, 2, 1.5, 5, 13.

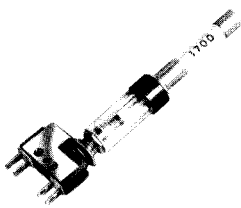

INDICATOR FUSE AND MICROSWITCH

ACCESSORIES


Table with 5 columns: Bulletin 2807, Type, A.C. V, Contact Rating, D.C. V, Outline. It lists accessories like Microswitch (FS2) and Clips (CL 1, CL 2) with their respective ratings.




1700

American Style Types SF Fuselinks
Serie Americana di Fusibili Tipo SF
Amerikanische Sicherungs-Reihe
Fusibles SF de Type Americain

Table for American Style Types SF Fuselinks. It includes columns for Type, IRMS at 25°C and 45°C, Pre-Arcing I²t, and I²t Max at 65V and 130V. It lists various models like SF13X5 through SF13X800 with their corresponding ratings.

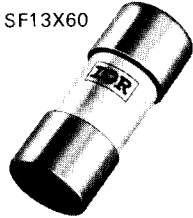


SF13X60

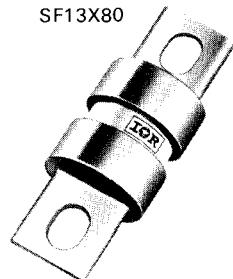

SF13X80

VRMS = 250V
IRMS = 5-600A
Bulletin 2811

Table for 250V SF Fuselinks. It includes columns for Type, IRMS at 25°C and 45°C, Pre-Arcing I²t, and I²t Max at 130V and 250V. It lists models like SF25X5 through SF25X600 with their ratings.

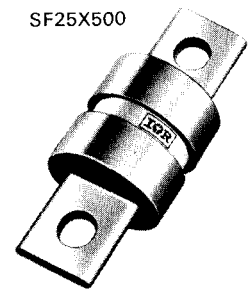

SF25X500